
TP-Link FW Release Notes

AC1200 Dual-Band Wi-Fi 5 VDSL/ADSL Modem Router

VR1200v(IT)2.0

Firmware Platform	BBA3.1.5
Firmware Version	1.3.0 3.1.4 v607c.0 Build 230807 Rel.27532n
Test Submitted Date	2023-08-08
Hardware Compatibility	EN7513G+EN7556+MT7613B+MT7592E+Si32280

Enhancement

FirmwareVersion	1.3.0 3.1.4 v607c.0 Build 230807 Rel.27532n
Base Firmware Version	1.2.0 3.1.4 v607c.0 Build 230329 Rel.32148n
Bug fix	Fixed market feedback: The device cannot register voice account and call under TIM line <ol style="list-style-type: none">1. Add DNS SRV2. Change SIP keep alive interval to 60s

FirmwareVersion	1.2.0 3.1.4 v607c.0 Build 230329 Rel.32148n
Base Firmware Version	1.1.0 3.1.4 v607c.0 Build 230209 Rel.48987n
Bug fix	Fix QA issue : When doing power on-off test, it has a probability of abnormal stuck during reboot

FirmwareVersion	1.1.0 3.1.4 v607c.0 Build 230209 Rel.48987n
Base Firmware Version	1.0.0 3.1.4 v607c.0 Build 221226 Rel.24939n
Bug fix	Fix QA issue: <ol style="list-style-type: none">1. After the DSL dial-up is successful, the EWAN port connects to

	<p>the Server on the premise that the DSL port is still trained for connection. In this case, disconnect the EWAN connection, DSL will fail register</p> <ol style="list-style-type: none">2. After LED Control take effect, and LAN LED still on, it should be off3. On the Basic Wireless Clients page, the wireless client is undefined4. The Oneplus9 Pro mobile phone cannot roaming from 2.4G to 5G5. Cannot set WanPPPConnection parameter to enable via ACS6. Cannot set MRU via ACS
--	--